




# **FLEX·CABLE**

## Engineered Solutions



### **Lunch Box**

Micro & Milli Ohm Meter  
Product Manual

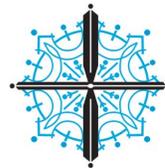

**T. J. SNOW CO.**

[www.tjsnow.com](http://www.tjsnow.com) | 1-800-NOW-SNOW (669-7669)

[P 423-894-6234](tel:423-894-6234) [f 423-892-3889](tel:423-892-3889) [e welders@tjsnow.com](mailto:welders@tjsnow.com)

120 Nowlin Ln., Chattanooga, TN 37421 | PO Box 22847, Chattanooga, TN 37422

## Engineered Solutions

In today's world of rapid growth and high technology, where a product can be here today and gone tomorrow; service, quality and technology are the key assets which separate the few from the many. For more than 55 years, Flex-Cable has developed these assets in order to be recognized as a leader in Resistance Welding Cable technology.

The Flex-Cable team has strived to set high standards and then go beyond them. The results? Operating at a world-class level of engineering and manufacturing capacity that allows for:

- ▶ Increased quality
- ▶ Increased flexibility
- ▶ Superior customer service
- ▶ Leading innovation
- ▶ Decreased cost
- ▶ Minimize lead time

This manual covers the specifications and operations of both the Micro Ohm Cable Tester (Part # MOCT-7550) and the Milli Ohm Cable Tester (Part # MOCT-7660).

[www.tjsnow.com](http://www.tjsnow.com) | 1-800-NOW-SNOW (669-7669)

 423-894-6234  423-892-3889  [welders@tjsnow.com](mailto:welders@tjsnow.com)

120 Nowlin Ln., Chattanooga, TN 37421 | PO Box 22847, Chattanooga, TN 37422

# Descriptions

## Micro-Ohm Meter

The Micro Ohm Cable Tester (MOCT7550) measures from 3 to 2000 micro ohms and can be used to measure the resistance of secondary weld circuit components. These include kickless cables, water cooled jumpers, laminated shunts, air cooled jumpers, weld gun castings, weld tips joints, weld transformers, oxidation in joints, connectors, or any component that can increase in resistance. This Meter is a tool that can be used for both preventive maintenance and for troubleshooting the secondary welding circuit.

**WARNING: ALL PRIMARY POWER MUST BE TURNED OFF AND DISCONNECTED BEFORE USING THIS METER ON SECONDARY COMPONENTS!**

## Milli-Ohm Meter

The Milli Ohm Cable Tester (MOCT7600) measures from 0.3 to 200 milli ohms and can be used to measure the resistance of primary (440 volt) weld circuit components. These include the primary supply cable, circuit breakers, crimped lugs, bolted joints or any component that can increase in resistance.

**WARNING: ALL PRIMARY POWER MUST BE TURNED OFF AND DISCONNECTED BEFORE USING THIS METER ON PRIMARY COMPONENTS! ADDITIONALLY, ANY CAPACITORS OR POWER STORAGE DEVICES MUST BE DISCONNECTED OR DISCHARGED BEFORE USING THIS METER!**

## Common

Both meters use a 4-wire Kelvin probe system. Each probe passes test current through the outer points of the probe and the voltage is sensed by the center pin. With this method, errors caused by the resistance of the leads and the contact resistance are eliminated. A stable 2.5 Amp Current source is incorporated into the meter providing high accuracy measurements to be displayed on a large 3 ½ digit LCD display.

An automatic power On/Off is incorporated in the meter to provide optimum battery life. Indicators on the LCD display warn of low battery voltage levels.

[www.tjsnow.com](http://www.tjsnow.com) | 1-800-NOW-SNOW (669-7669)

 423-894-6234  423-892-3889  [welders@tjsnow.com](mailto:welders@tjsnow.com)

# Specifications

## Measuring Range

MOCT7550	3 - 1999
MOCT7600	0.3 - 199

## Accuracy

Relative accuracy	<1% of F.S.
Absolute accuracy	<2% of F.S.

## Measuring Current

2.5 Amps

## Power Supply

Measuring Current & Display	1) ea. 12 Volt
-----------------------------	----------------

## Display

Type	LCD
Digits	3 1/2
Height	0.7" (18mm)

## Est. Battery Life

Current on	1.25 hour
Number of checks (10 sec.)	450

## Dimensions

Length	8 1/4"
Width	7"
Depth	3 3/4"

[www.tjsnow.com](http://www.tjsnow.com) | 1-800-NOW-SNOW (669-7669)

 423-894-6234  423-892-3889  [welders@tjsnow.com](mailto:welders@tjsnow.com)

120 Nowlin Ln., Chattanooga, TN 37421 | PO Box 22847, Chattanooga, TN 37422

# Operation

Connect both meter cables to the connectors on the right side of the box. Press one probe to each end of the component being tested. The meter senses the component being tested and turns itself on. If the sample under test is totally open the meter will not turn itself on.

After the meter is turned on the current source circuit is activated to maintain 2.5 amps. When the current is stable at 2.5 amps the “Display Hold” indicator goes off and resistance readings are displayed. If the sample under test has a resistance greater than the capacity of the meter, the “Display Hold” indicator will stay on and no numbers will be displayed.

When a stable reading is displayed the probes can be removed. (Note: Holding the probes tightly against the component being tested will aid in stabilizing the reading). Remove the probes quickly so as not to bounce the probes. The display hold indicator will come on and the display will hold the last reading momentarily.

After the hold period, the meter will automatically turn off and the display will go blank.

**NOTE: DO NOT PLACE THE PROBES ON A CIRCUIT THAT HAS VOLTAGE ON IT. THIS COULD CAUSE PERMANENT DAMAGE TO THE INPUT CIRCUITRY.**

[www.tjsnow.com](http://www.tjsnow.com) | **1-800-NOW-SNOW** (669-7669)

**p** 423-894-6234 **f** 423-892-3889 **e** [welders@tjsnow.com](mailto:welders@tjsnow.com)

120 Nowlin Ln., Chattanooga, TN 37421 | PO Box 22847, Chattanooga, TN 37422

# Maintenance

## Battery - 12 Volt Rechargeable

When the word “BAT” is displayed this indicates that the “12 Volt” battery voltage is running low and will soon need to be recharged.

To recharge the “12Volt” battery, plug the 18 Volt power supply into the battery connector. The LED will come on and stay on until battery is charged, about 6 hours. When the LED light goes off the charging unit goes to a lower voltage to maintain the charge.

## Battery - Replacement “C”

When the word “BAT” is displayed this indicates that the battery voltage is running low and will soon need to be replaced.

Replace old batteries with new “C” size batteries using the alignment stickers as a guide.

## Using your Meter

The Flex-Cable Micro Ohm Meter may be used to measure the resistance of very high conductivity conductors such as copper cables, laminated shunts and copper buss bars.

Because of its capability of detecting increases in resistance of these items, the meter may be used for trouble-shooting problems with secondary welding circuits. An increase in resistance is one criterion that has been used effectively to eliminate downtime attributed to cables. Use procedures are as follows:

**NOTE: FOR MORE INFORMATION ON TROUBLE-SHOOTING  
AND PREVENTATIVE MAINTENANCE PROGRAMS,  
PLEASE CONTACT YOUR SALES REPRESENTATIVE**

[www.tjsnow.com](http://www.tjsnow.com) | **1-800-NOW-SNOW** (669-7669)

**p** 423-894-6234 **f** 423-892-3889 **e** [welders@tjsnow.com](mailto:welders@tjsnow.com)

120 Nowlin Ln., Chattanooga, TN 37421 | PO Box 22847, Chattanooga, TN 37422

# Preventative Maintenance

- 1) Monitor cable resistance in the secondary weld circuit on a periodic basis.
- 2) When the resistance has reached a level that would result in a defective weld, the cable should be changed. The resistance level at which you change the cable should be determined on a case by case or plant by plant basis because of the multitude of factors effecting cable life, weld schedules, inspection intervals, etc.

For More information see Reducing & Eliminating Down-Time in Resistance Welding Systems.



**Reducing and Eliminating Down-Time  
in Resistance Welding Systems**  
Preventative Maintenance Handbook

[www.flexable.com](http://www.flexable.com)  
[sales@flexable.com](mailto:sales@flexable.com)

[www.tjsnow.com](http://www.tjsnow.com) | 1-800-NOW-SNOW (669-7669)

 423-894-6234  423-892-3889  [welders@tjsnow.com](mailto:welders@tjsnow.com)

120 Nowlin Ln., Chattanooga, TN 37421 | PO Box 22847, Chattanooga, TN 37422

# Trouble-Shooting Problems

1. Take a 'base' resistance reading when all components are known to be good i.e. new, clean, well-tightened connections. The complete secondary circuit can be measured at the gun from tip to tip; separate components can be measured without removing them from the secondary circuit. This resistance reading should be recorded and stored for when a problem arises.
2. When a problem arises, take another resistance reading and compare this reading with a 'base' reading. If it is significantly high enough to have caused the problem, proceed to the next step. If it is not high enough, than the problem may not lie within the secondary weld loop.
3. If you get a high resistance reading from the complete loop, you must then take resistance reading for each component that could be causing the problem. The components do not need to be taken out of the circuit and indeed should not be taken out of the circuit as the problem may be a loose bolt and this would not be found if components are removed. Note: More stable readings will be obtained if the area where the probe is placed is cleaned with an abrasive cleansing pad prior to the readings being taken.
4. Once the problem causing component is found, take the appropriate actions to remedy the problem.

# Replacement Parts & Accessories

<u>Description</u>	<u>Part Number</u>
Micro Ohm Meter	MOCT7550
Milli Ohm Meter	MOCT7600
Carrying Strap	250-7878-36
Lead & Probe Assemblies (Pair 4ft)	250-7253-48
Probe Leads (Pair 4ft)	600-8023-48
Probe Leads (Pair 6ft)	600-8023-72
Probe Leads (Custom Length)	Please Call
Probes (Pair)	250-7702-00
Shrink Tube (Pair for Leads)	250-0301-00
Clamping Probe & Lead (Single 6ft)	250-2519-72
Pistol Probes & Leads (Pair 4ft)	250-7478-48
Pistol Probe Leads (Pair 4ft)	250-7783-48
Pistol Probe Leads (Custom Length)	Please Call
Rechargeable 12 Volt Battery/Charger	250-7274-12
Replacement Charger	250-7324-18

[www.tjsnow.com](http://www.tjsnow.com) | **1-800-NOW-SNOW** (669-7669)

**p** 423-894-6234 **f** 423-892-3889 **e** [welders@tjsnow.com](mailto:welders@tjsnow.com)

120 Nowlin Ln., Chattanooga, TN 37421 | PO Box 22847, Chattanooga, TN 37422

# Flex-Cable's Other Product Lines

Flex-Cable doesn't just make products, we solve problems in the manufacturing sector for all customers.



## Custom Cables

Rectangular Connectors	Custom Assemblies
Military Connectors	Private Label Over-Molding
Circular Connectors	I/O Fan Out Cables



## Motion Control Cables

Servo Motor Cables	Servo Motor Purge Cables	Break-Out Boards
Servo Motor Extension Cables	Resistive Brake Module Cables	Transition Cables
Servo Motor Box Mount Cables	Stand-Alone Encoder Cables	Feedback Cables



## Robot Dress

Components (Clamps, Brackets, etc)	Universal Dress Systems	Custom Umbilicals
Retract Dress Systems	MIG Assemblies	Robot Bypass Box
Static Dress Systems	Cables & Hose Protection	



## Bus Bars

Solid Bus Bar w/ PEM Studs	Flexible Bus Bar	Shielded Bus Bar
Round Cable to Flexible Bus Bar	Round Cable	Aluminum Bus Bar
Round to Flat to Round Wire	Solid to Flexible Bus Bar	Jumpers



## Furnace Products

Carbon Arc Cables	Low Impedance Cables
Induction Furnace Cables	Air Cooled Cables
Induction Heating Cables	Copper Repair & Rebuild Services



## Injection Molding

Custom Molded Plastic Parts	Short Run & Prototype Molds
Plating Options Available	Multi-Component Capability
Finishing Options Available	



## Copper Stamping and Fabrication

Hybrid/Electric Vehicle Specialty	High Production Capability
Simple Blankings	Non-Ferrous Specialty
Complex Stamping Dies	Plasma Cutting




## Metal Fabrication

Sheet Metal Fabrication	Turning
Welding Services	Custom Machining
Milling & Drilling	Plating Options Available



# **FLEX·CABLE**

Engineered Solutions

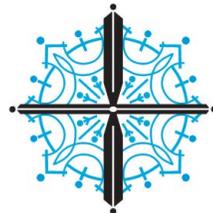

**T. J. SNOW CO.**

[www.tjsnow.com](http://www.tjsnow.com) | 1-800-NOW-SNOW (669-7669)

[p 423-894-6234](tel:423-894-6234) [f 423-892-3889](tel:423-892-3889) [e welders@tjsnow.com](mailto:welders@tjsnow.com)

120 Nowlin Ln., Chattanooga, TN 37421 | PO Box 22847, Chattanooga, TN 37422